

Work Order ID 92366

92366

Page 1

October-30-12 9:17:12 AM

Item ID: D3121-21 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Bolt
 Start Date: 10/29/12 Start Qty: 40.00 *40* Cust Item ID:
 Required Date: 11/16/12 Req'd Qty: 40.00 *40* Customer:
 Reference:

Approvals: Process Plan: WLS Date: 12-10-30 Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D3121	Rev E

100	Hardinge CNC LATHE SMALL	0.00							
100									
Hardinge	Memo	0.00							
Hardinge CNC Lathe Small	1-Turn D3121-21 2-Identify as D3121-213-Deburr break all sharp edges 0.005" to 0.010"								

110	QC2- Inspect parts off machine FAI/FAIB	0.00							
110									
QC	Memo	0.00							
Quality Control									

120	QC8- Inspect parts - second check	0.00							
120									
QC	Memo	0.00							
Quality Control									

DAS
04
8-83

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>					Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																							
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																							
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																							
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																								
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																	
Doc/Data <input type="checkbox"/>																										
Equip/Tooling <input type="checkbox"/>																										
Operator <input type="checkbox"/>																										
Material <input type="checkbox"/>																										
Setup <input type="checkbox"/>																										
Other <input type="checkbox"/>																										
Process <input type="checkbox"/>																										
Supplier <input type="checkbox"/>																										
Training <input type="checkbox"/>																										
Unapproved <input type="checkbox"/>																										

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	

Work Order ID 92366

92366

Page 2

October-30-12 9:17:12 AM

Item ID: D3121-21 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Bolt
 Start Date: 10/29/12 Start Qty: 40.00 ***40*** Cust Item ID:
 Required Date: 11/16/12 Req'd Qty: 40.00 ***40*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	Identify as per dwg & Stock Location: <i>ST</i>	0.00							
130									
Packaging	Memo	0.00							
Packaging									
140	QC21- Final Inspection - Work Order Release	0.00							
140									
QC	Memo	0.00							
Quality Control									

10/24/12 (40)

12/12/12

MF 12-12-12

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"><tr><td>Skid-tube <input type="checkbox"/></td><td>Crosstube <input type="checkbox"/></td><td>Water Jet <input type="checkbox"/></td><td>Engineering <input type="checkbox"/></td></tr><tr><td>Machining <input type="checkbox"/></td><td>Small Fab <input type="checkbox"/></td><td>Prod. Eng. Coord. <input type="checkbox"/></td><td>Quality <input type="checkbox"/></td></tr><tr><td>Thermoforming <input type="checkbox"/></td><td>Finishing <input type="checkbox"/></td><td>Rec/Store/Packaging <input type="checkbox"/></td><td>Other <input type="checkbox"/></td></tr><tr><td>Large Fab <input type="checkbox"/></td><td>Composite <input type="checkbox"/></td><td>Supplier <input type="checkbox"/></td><td></td></tr></table>					Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																							
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																							
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																							
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																								
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																	
Doc/Data <input type="checkbox"/>																										
Equip/Tooling <input type="checkbox"/>																										
Operator <input type="checkbox"/>																										
Material <input type="checkbox"/>																										
Setup <input type="checkbox"/>																										
Other <input type="checkbox"/>																										
Process <input type="checkbox"/>																										
Supplier <input type="checkbox"/>																										
Training <input type="checkbox"/>																										
Unapproved <input type="checkbox"/>																										
FAULT CATEGORY																										
<table style="width:100%; border: none;"><tr><td style="width:33%; vertical-align: top;">Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube</td><td style="width:33%; vertical-align: top;">General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio</td><td style="width:33%; vertical-align: top;"><input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions</td><td style="width:33%; vertical-align: top;"><input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge</td><td style="width:33%; vertical-align: top;"><input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other</td></tr></table>										Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other												
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other																						

Picklist Print

October-30-12 9:17:11 AM

Page 1

Work Order ID: 92366

Parent Item: D3121-21

Start Date: 10/29/12

Required Date: 11/16/12

Parent Item Name: Bolt

Start Qty: 40.00

Required Qty: 40.00

Comments: IPP A04.02.09New issueKJ/DS
IPP Rev:B ECN 1060 07-11-12 DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
M303H0.500 303 HEX BAR .500		Purchased	No			110	f	17.4350	0.0417	1.6041 ⁶⁶⁸		12/12/06	

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
MAT037	17.435	
109778	3.152	
121282	1.583	
121380	0.7	
123279	12	

1.6041

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____


QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											


FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

DART**RELEASED**
07.11.07


DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 1 OF 10
DATE 07.11.07	TITLE BRACKET ASSEMBLY		SCALE 1:2
A	02.04.15	NEW ISSUE	
B	03.01.16	ADD RIDGES; ADD MAT'L PROP; FIX P/N ADD -141/-143/-144/-145/-146	
C	04.02.17	ADD CLEARANCE; USE -241 BEARING	
D	06.05.17	D3121-25 CAP WAS 1.024, NOW 1.000	
E	07.11.07	ADD TOLERANCE TO 0.032 (DETAIL B)	

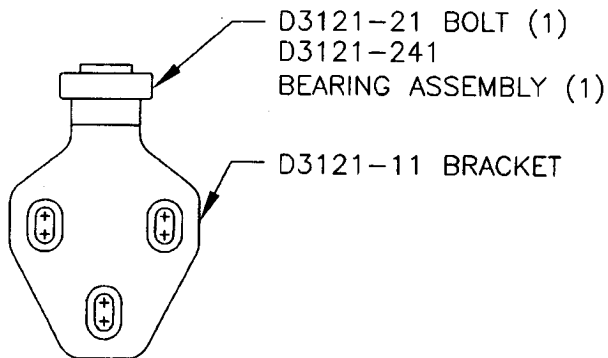

D3121-041 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-33)

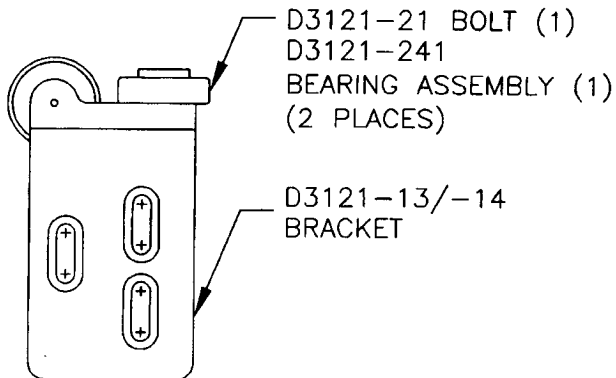

D3121-043 (SHOWN) / D3121-044 (OPPOSITE) BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-37/-38)

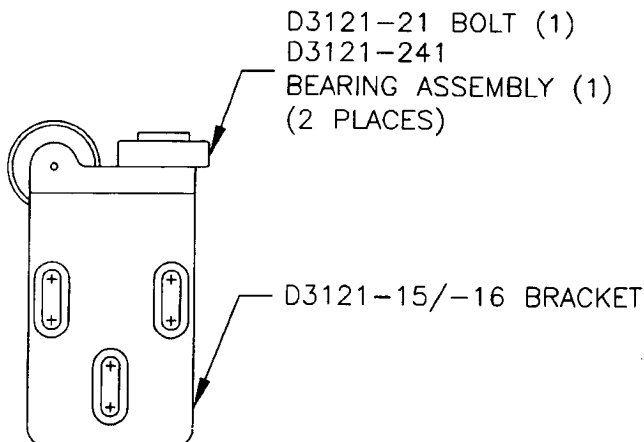

D3121-045 (SHOWN) / D3121-046 (OPPOSITE) BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-35/-36)


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO 92366 HCS
12-10-30

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 2 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

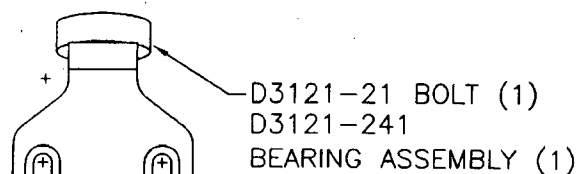


D3121-21 BOLT (1)
D3121-241
BEARING ASSEMBLY (1)

D3121-111 BRACKET

D3121-141 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23001-01)


RELEASED
07.11.07 W

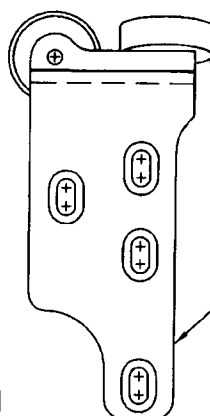

D3121-21 BOLT (1)
D3121-241 BEARING ASSEMBLY (1)
(2 PLACES)

D3121-113/-114 BRACKET

**D3121-143 (SHOWN) / D3121-144 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-03/-04)

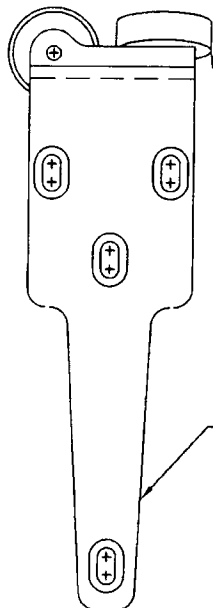

D3121-21 BOLT (1)
D3121-241 BEARING ASSEMBLY (1)
(2 PLACES)

D3121-115/-116
BRACKET

**D3121-145 (SHOWN) / D3121-146 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-05/-06)

Copyright © 2002 by DART AEROSPACE LTD



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 3 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1


**DETAIL A:
SLOT DETAIL**
SCALE 2:1
VIEW ROTATED

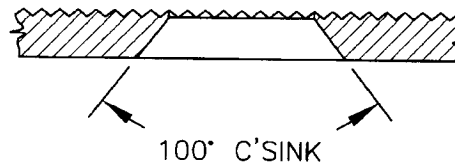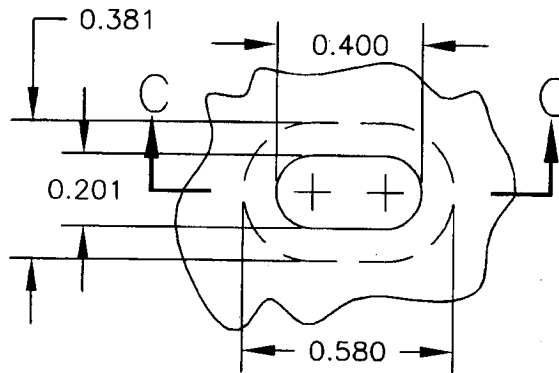

**SECTION
C-C**

RELEASED
07.11.07

**DETAIL B:
RIDGE DETAIL**
PARTIAL SECTION
SCALE 1:20

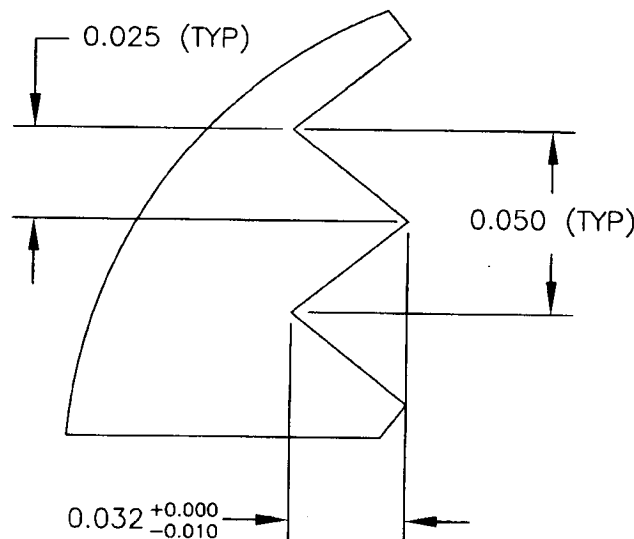


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 4 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1

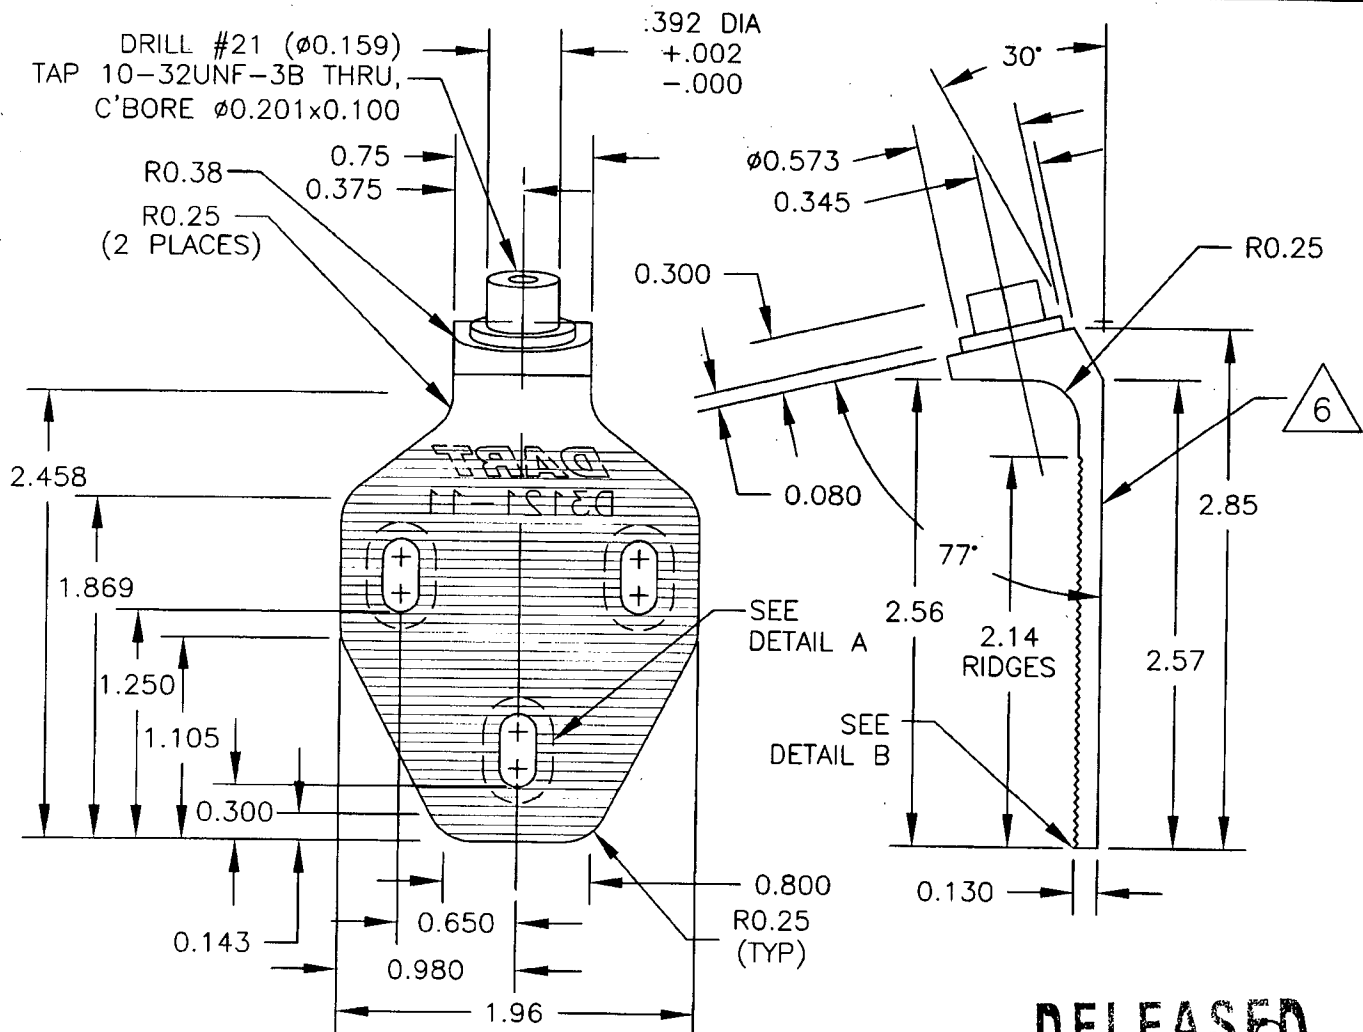
**RELEASED**
07.11.07**D3121-11 BRACKET**





- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N & LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2004 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366



DESIGN 	DRAWN BY 	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED 	APPROVED 	DRAWING NO. D3121	REV. E SHEET 5 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

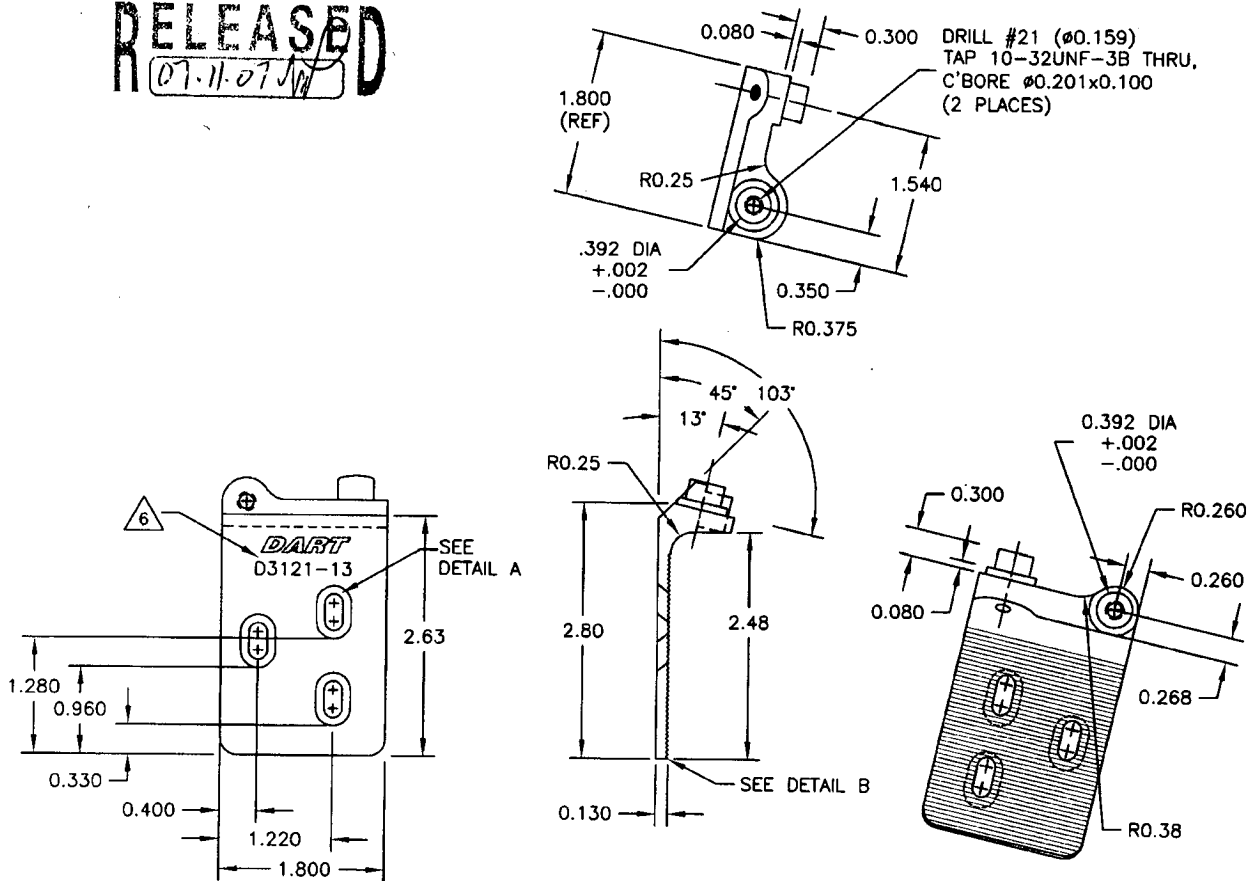

D3121-13 BRACKET (SHOWN)

D3121-14 BRACKET (OPPOSITE)

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N & LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 6 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

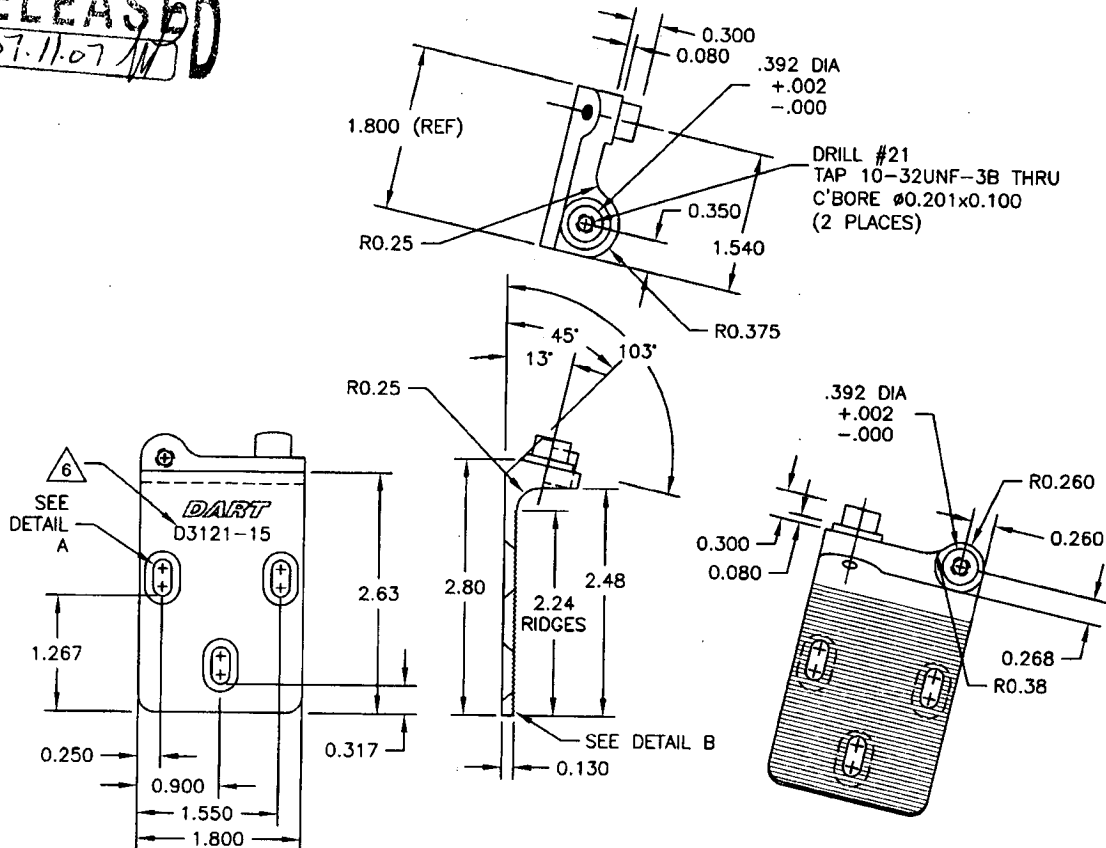RELEASED
07.11.07**D3121-15 BRACKET (SHOWN)****D3121-16 BRACKET (OPPOSITE)**

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N AND LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 7 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

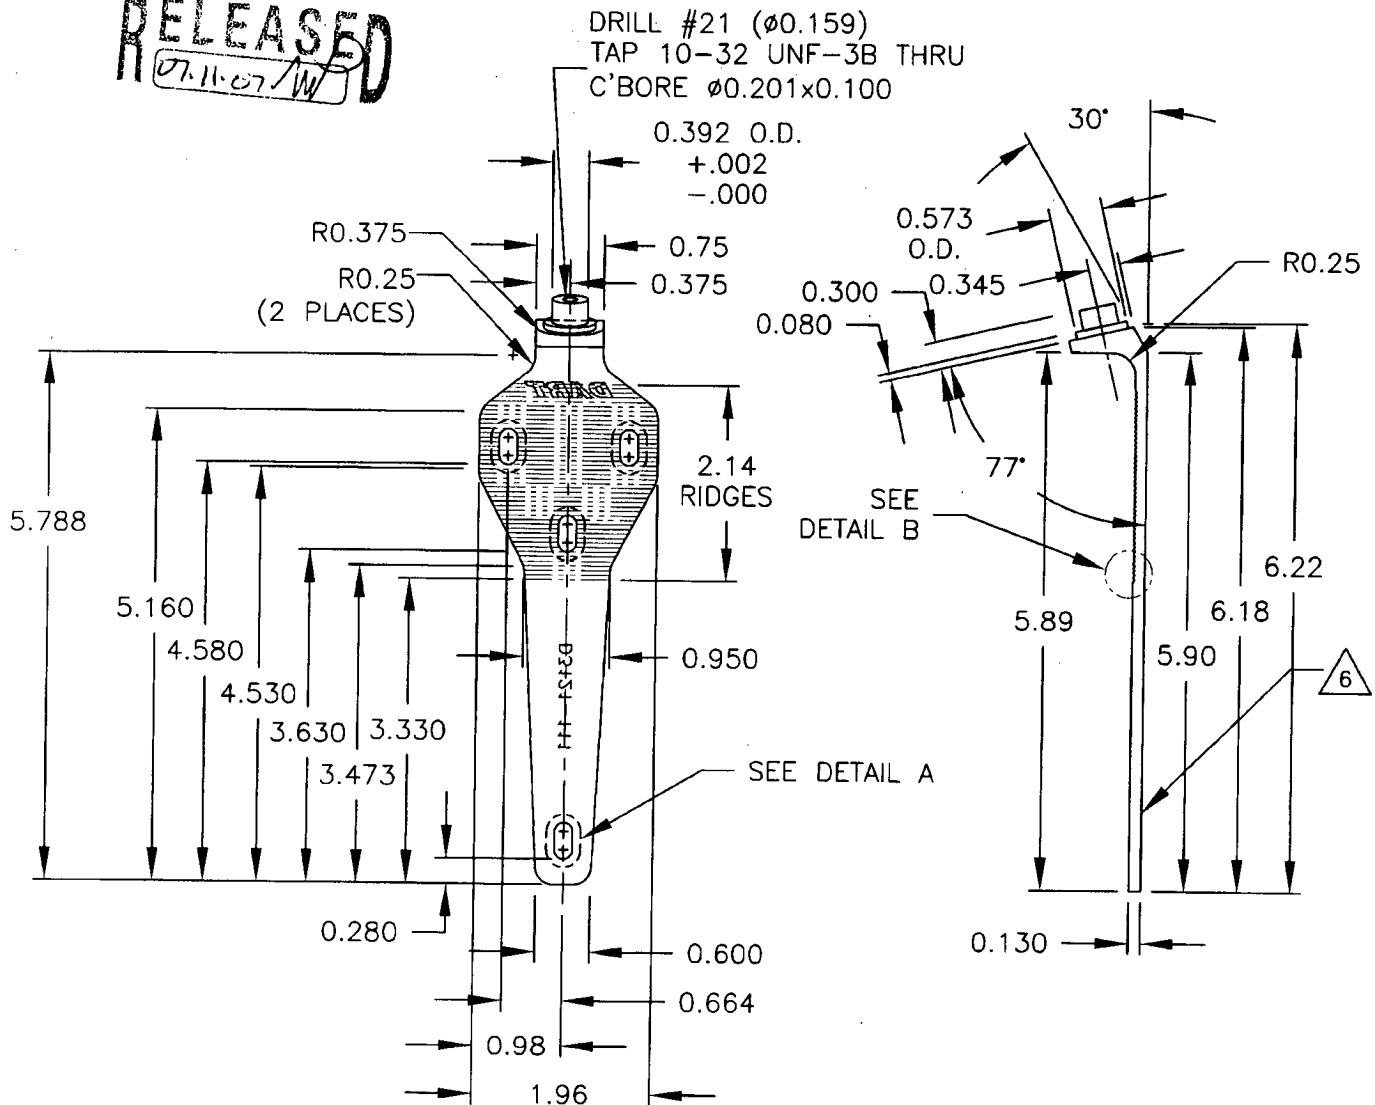RELEASED
07.11.07/W**D3121-111 BRACKET**

- 1) REPLACES PREMIER P/N B32-23001-11
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

Copyright © 2002 by DART AEROSPACE LTD


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 8 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

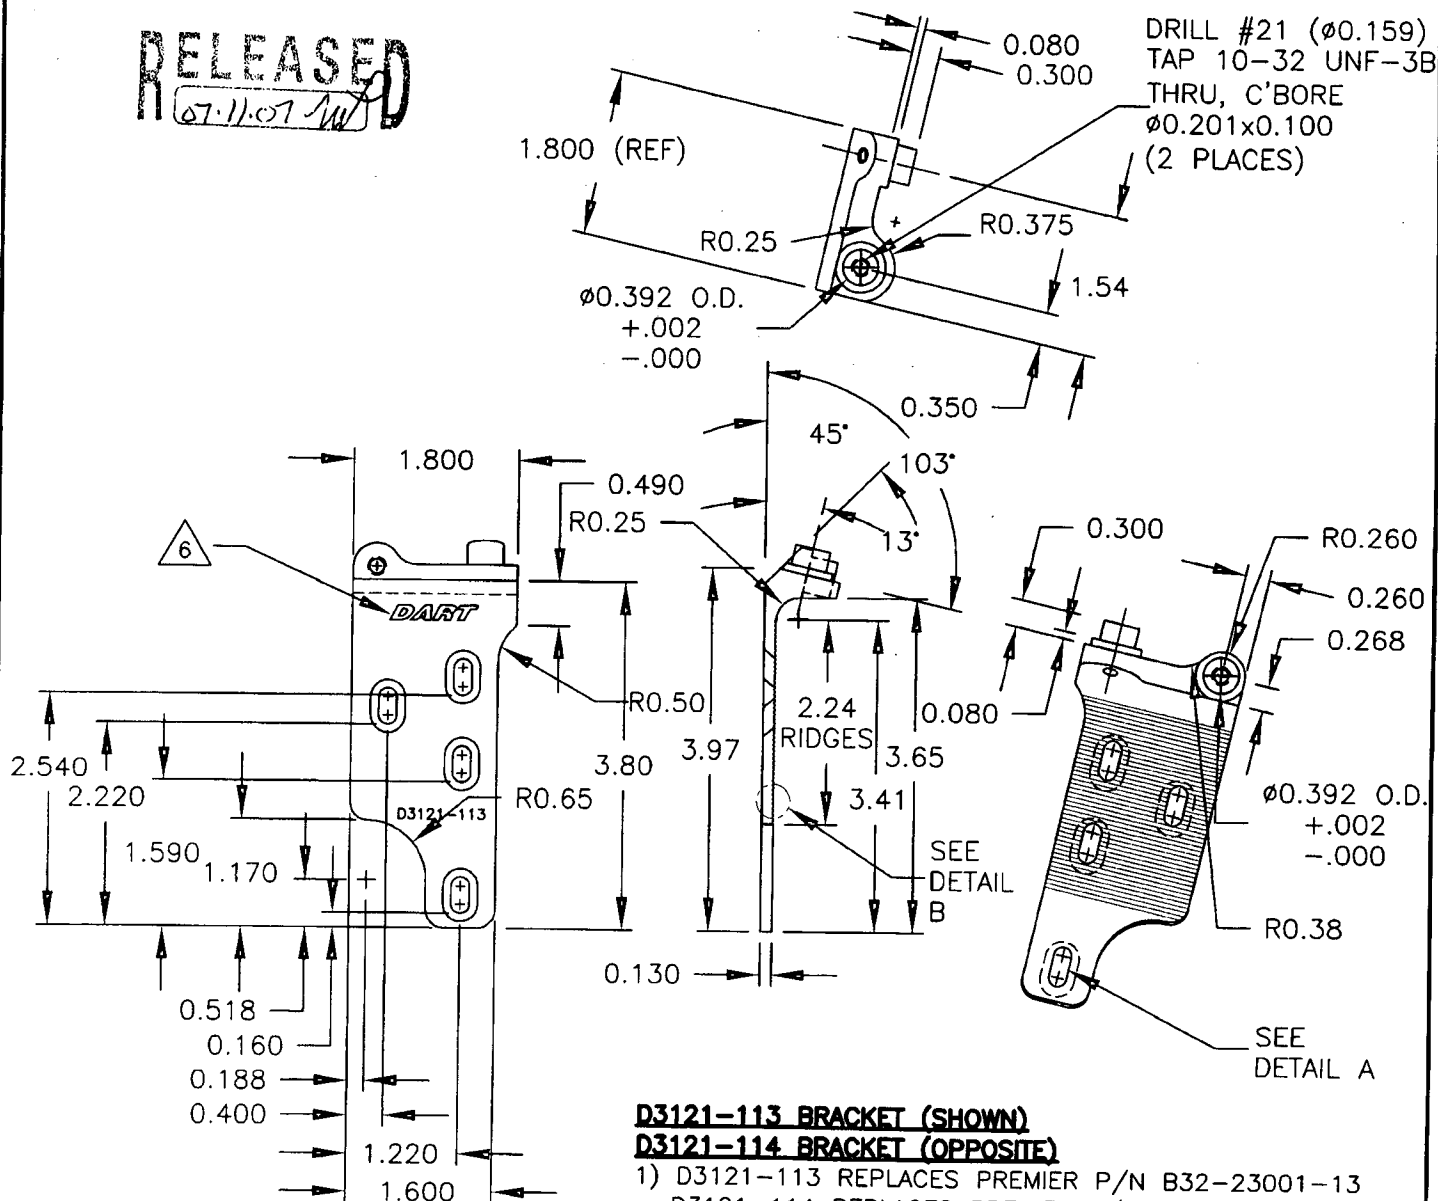

D3121-113 BRACKET (SHOWN)


D3121-114 BRACKET (OPPOSITE)

- 1) D3121-113 REPLACES PREMIER P/N B32-23001-13
D3121-114 REPLACES PREMIER P/N B32-23001-14
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366

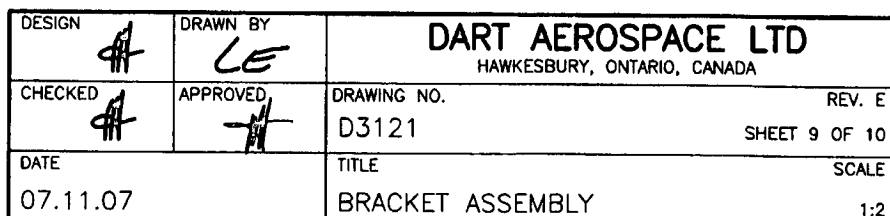

RELEASED
07-11-07

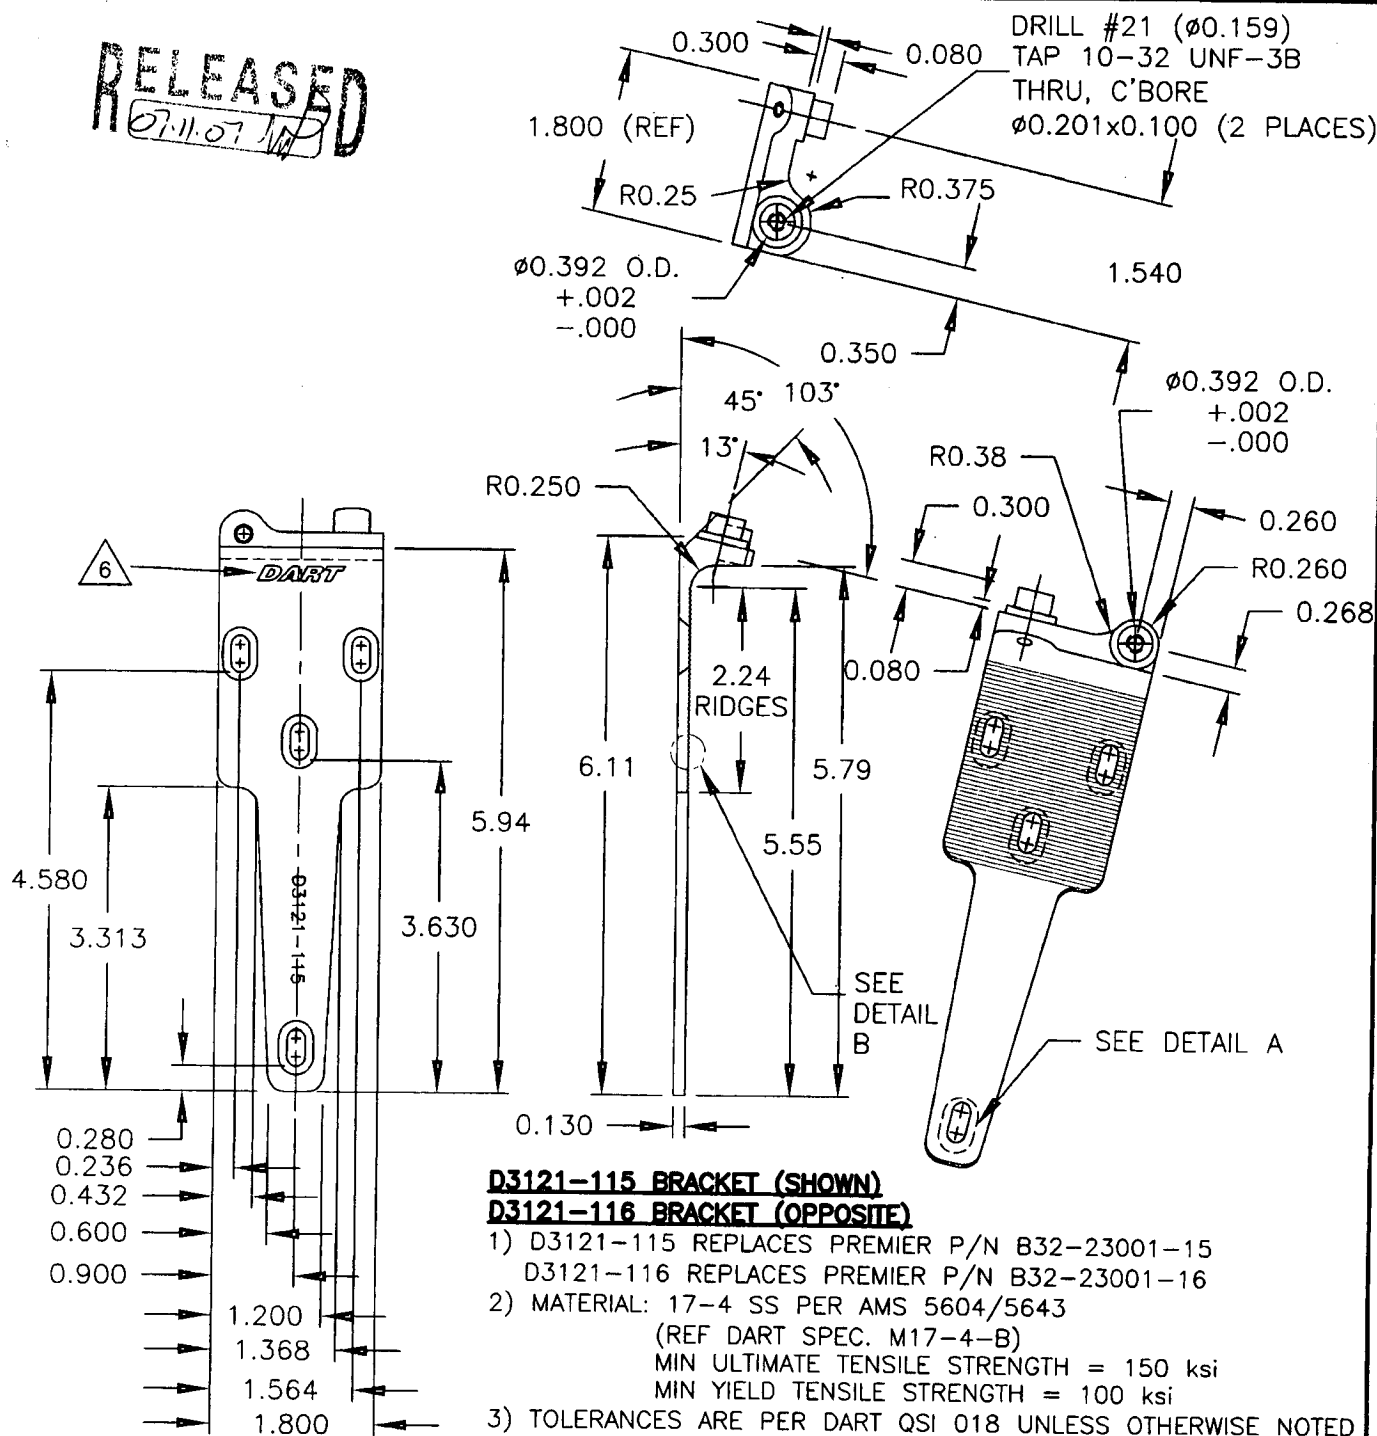

D3121-115 BRACKET (SHOWN)
D3121-116 BRACKET (OPPOSITE)

- 1) D3121-115 REPLACES PREMIER P/N B32-23001-15
D3121-116 REPLACES PREMIER P/N B32-23001-16
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


92364

DART


DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 10 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1

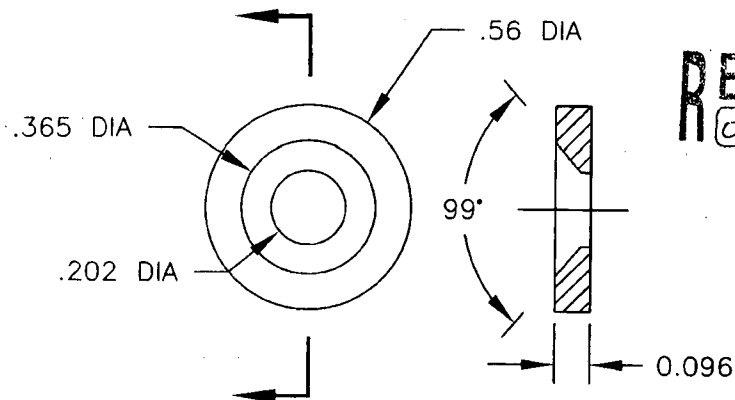**D3121-17 WASHER (SCALE 2:1)**


- 1) REPLACES PREMIER P/N B32-23001-17
- 2) MATERIAL: AISI 303 SS ROUND BAR, ANNEALED (REF DART SPEC. M303R)
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

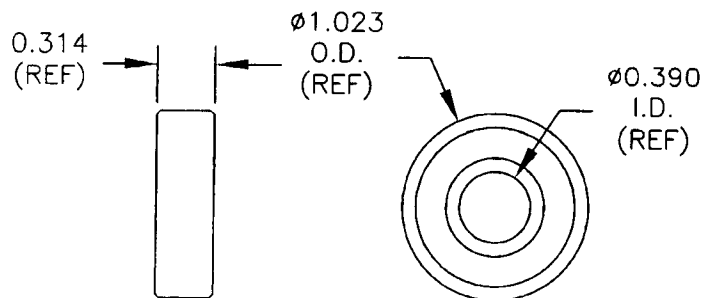**D3121-19 BEARING (SCALE 1:1)**


- 1) POSSIBLE SUPPLIER: KING BEARING P/N 6000-2ZJ/EM FAFNIR P/N 9100KDD
- 2) ALL DIMENSIONS ARE IN INCHES

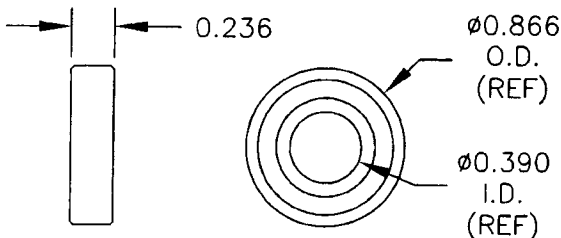**D3121-23 BEARING (SCALE 1:1)**


- 1) POSSIBLE SUPPLIER: SKF P/N 61900-2Z OR KML P/N 6900-2Z
- 2) ALL DIMENSIONS ARE IN INCHES

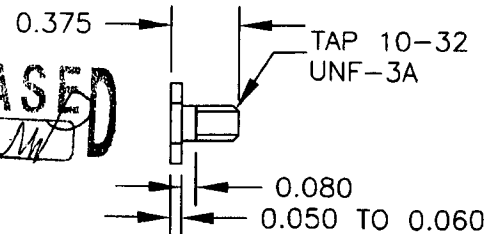**D3121-21 BOLT (SCALE 1:1)**

- 1) MATERIAL: AISI 303 SS HEX, ANNEALED (REF DART SPEC. M303H0.500)
- 2) FINISH: NONE
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

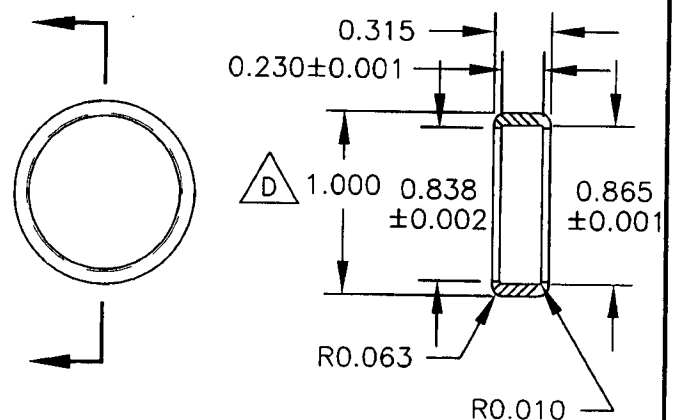**D3121-25 CAP (SCALE 1:1)**

- 1) MATERIAL: DELRIN ROD, Ø1.25 (REF DART SPEC. M-DELRIN-R1.250)
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES

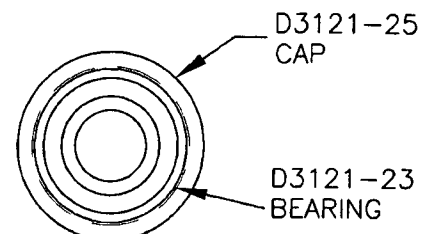**D3121-241 BEARING ASSEMBLY (SCALE 1:1)**

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92366